

The Campbell Group

Campbell Hausfeld • Wayne • Powerwinch

Instructions/Attach To:

USCN088

Date: 10/18/00

Page: 1 of 1

From: Consumer Engineering

Concerning: Repair Kit for New WL Air Compressors

Models Affected: WL650000AJ, WL650100AJ, WL650200AJ, WL650300AJ, WL650400AJ, WL660000AJ, WL660100AJ, WL660300AJ, WL660400AJ, WL611104AJ, WL604010AJ.

TO ALL AUTHORIZED SERVICE CENTERS:

A repair kit, part # WL015100AJ, has been developed to service the new WL "Millenium" Series air compressors. This kit is specifically for those units that have failed drive belts. The kit includes:

- Pump/Motor Assembly
- New Check Valve with pre-installed mesh screen.
- New Thick Rubber Ferrules

This new kit addresses and corrects the problem of debris getting caught in the check valve during installation of the exhaust tube. Because of the expense of replacing the entire motor we are looking at making a tool and procedure that will allow the belt to be replaced instead. We will provide this information as soon as its available.

Please make note of the following service procedures when repairing these units:

Check valve should be checked for debris in the outlet if the unit is being serviced for a failed drive belt.

Debris may keep the outlet open, and not allow the compressor head to unload. This causes the failure of the belt. If debris is found in the check valve, the check valve MUST be replaced – part # CV221506AV.

If you have questions, please call your customer service representative.
Thank you for your cooperation in this matter.

Product Service Department.