

# The Campbell Group

Campbell Hausfeld • Wayne • Powerwinch

From: Consumer Engineering

Concerning: New Piston Bolts – “WL Millenium Series”

Instructions/Attach To:

# USCN089

Date: 10/18/00

Page: 1 of 1

Models Affected: WL650000AJ, WL650100AJ, WL650200AJ, WL650300AJ, WL650400AJ, WL660000AJ, WL660100AJ, WL660300AJ, WL660400AJ, WL611104AJ, WL604010AJ.

TO ALL AUTHORIZED SERVICE CENTERS:

When performing any repairs to the New “WL Millenium Series” Air Compressor, please watch for an unmarked zinc coated silver bolt (see below) that attaches the piston to the eccentric. The part number for this bolt is ST071802AV. This bolt appears on some compressors built from approximately June 15, 2000 through September 23, 2000. The round date code decal should appear on the fan shroud detailing this production date.

This bolt is coated with too much zinc, which prevents proper torque (300-inch lbs.) of the piston bolt to the eccentric. The result may be a broken piston bolt over a period of usage. Please replace this bolt with the new BLACK piston bolt supplied by Campbell Hausfeld. Please return any unmarked SILVER bolts that you have in inventory to Campbell Hausfeld for exchange.

**Under no circumstances is the unmarked silver bolt to be used in any repairs.**

If the piston bolt is a marked (with “O-A-V”) zinc coated bolt, such as the one below, than the bolt is fine and does not need replacing.



Please call the your customer service representative if you have questions.

Thank you for your cooperation.