

The Campbell Group

Campbell Hausfeld • Wayne • Powerwinch

Instructions/Attach To:

USCN081

Date: 9/7/2000

Page: 1 of 1

From: Product Service

Concerning: WL Compressor Instrument Panel Removal

When servicing the new WL oil-less air compressors fitted with the instrument panel and shroud assembly, care must be taken to prevent damage to the power switch. After switching the unit off and unplugging the unit from the power source, the unit must be then switched to the ON position to remove the upper shroud. Failure to do this will result in the control lever on the pressure switch being broken.

If a lever is broken, any debris from the old lever left in the pressure switch should be removed with a needle nose pliers or similar instrument. Be sure to unplug the power source before performing this operation. A new power switch (part # WL010400AV) can then be installed.

Units that are affected by this bulletin are:

- WL650000AJ
- WL650100AJ
- WL650200AJ
- WL650300AJ
- WL650400AJ
- WL660000AJ
- WL660100AJ
- WL660300AJ
- WL660400AJ
- WL611104AJ
- WL604010AJ

